



Environment and
Climate Change Canada

Environnement et
Changement climatique Canada

QA Summary of Research Consortium Cruise 2019259-010-006

Provided in accordance with Document RS-10-002

WQA Program Version 1.01

December 18th 2019

Internal Document

RSWQA-2019259-010-006

Paige Neal

Technologist, Scientific Support | Technologue, Soutien scientifique

Water Science & Technology Directorate | Science de l'eau et de la technologie

Science & Technology Branch | Direction générale des sciences et de la technologie

Environment and Climate Change Canada | Environnement et Changements Climatiques Canada

Government of Canada | Gouvernement du Canada

867 Lakeshore Road | 867, chemin Lakeshore

Burlington, ON L7S 1A1

Paige.Neal@Canada.ca

Telephone | Téléphone (905) 336-4531

Website | Site Web www.canada.ca

Table of Contents

1. Scope 3

2. Terms and Definitions 3

3. QA Assessment 5

 3.1. Stations Analyzed..... 5

 3.2 Changes/Corrections/Comments..... 7

4. Map of Stations 8

5. Corrective Action 9

6. References 10

1. Scope

This internal document describes the details on the QA assessment of shipboard seabird profiles collected in **Lake Winnipeg** on the **2019259-010-006 Research Consortium Cruise**. A total of **46** stations were visited that commenced on **2019-09-16** and ended on **2019-10-04**. The QA officer assessed the quality of the shipboard data and prepared it for the principle investigator on **2019-12-18**.

2. Terms and Definitions

Cast	The act of collecting one depth-profile with a sonde onboard a research ship.
Cruise	A trip travelled through a body of water by ship where depth-profiles are collected at pre-arranged stations. Cruise Numbers have become more descriptive, based on the year and the first Julian Day of the cruise, the lake identifier, and the vessel identifier. For example, 2016130-010-006 indicates that on May 9, 2016, a Lake Winnipeg (lake 010) cruise was conducted onboard the Namao (vessel 006).
CSN	Consecutive Station Number
Depth-profile	A quantitative analysis of a section of a body of water representing distinctive water quality characteristics with respect to depth.
DO	Dissolved oxygen
Erroneous (data)	Data points that measure outside the expected instrumental range, or values considered globally impossible, which are typically observed as single spikes in the data
Headerline	Information in a data file located in the lines preceding the data columns. File, station, and instrument information (including calibration coefficients) are found here.
OIC	Officer In Charge
PSN	Permanent Station Number
QA	Quality Assurance
QAS	Quality Assurance Annual Summary
QAO	Quality Assurance Officer
Q'd file	Data file that has been assessed by a quality assurance officer.

RFUB	Relative Fluorescence Units blank subtracted. Units for chlorophyll are in these units in the processed data files, unless quantified concentrations are made available, in which they will be corrected.
SB (or SBE or WQP)	SeaBird Water Quality Profiler; four-channel profiling sonde. Raw output include .hex, .xmlcon, and .hdr for each profile. Processed "raw" file has a .cnv file extension. Fully processed and QC'd files that include the calibration coefficients for the optical sensors as well as the DO corrections have the extension .xls (4 Hz) and _DepthAvg.xls (depth-averaged in 0.5 m increments). Sensors include: depth (m), temperature (°C), specific conductance (µS/cm), dissolved oxygen (mg/l and %saturation), turbidity (NTU), chlorophyll (RFUB), and descent rate (m/s). The raw .cnv data files have the optical sensors (turbidity and chlorophyll) output in voltage, although the raw output file may state otherwise. The coefficients for the two optical sensors are input into the .xmlcon file for each SeaBird. The raw output .cnv files contain the calculated RFU values rather than the voltages. These calculated values are calibrated to best-approximated concentration units, if in-situ measurements are available. Surface PAR and underwater PAR data now available ($\mu\text{Em}^{-2}\text{s}^{-1}$). Underwater PAR data is not corrected to surface PAR.
Shipboard	Pertaining to activities performed and equipment used on board a research vessel.
Station	A pre-set location within a body of water classified with a unique number and identified by its GPS location.
Suspicious (data)	Data points that do not follow the expected trend (based on historical and statistical reasoning). However, this does not necessarily imply that the data is false.
WQA	Water Quality Assurance
WQAS	Water Quality QA Summary

3. QA Assessment

3.1. Stations Analyzed

Table 3-1. Seabird profile stations assessed by QA

FILENAME	STATION
2019259-010-006_2_035_01.mat	2
2019259-010-006_3B_047_01.mat	3B
2019259-010-006_3C_046_01.mat	3C
2019259-010-006_5_044_01.mat	5
2019259-010-006_7_042_01.mat	7
2019259-010-006_9_041_01.mat	9
2019259-010-006_12B_003_01.mat	12B
2019259-010-006_13B_005_01.mat	13B
2019259-010-006_19_012_01.mat	19
2019259-010-006_20_014_01.mat	20
2019259-010-006_21_016_01.mat	21
2019259-010-006_22_017_01.mat	22
2019259-010-006_23S_026_01.mat	23S
2019259-010-006_26S_023_01.mat	26S
2019259-010-006_28_025_01.mat	28
2019259-010-006_31_022_01.mat	31
2019259-010-006_33_021_01.mat	33
2019259-010-006_34S_020_01.mat	34S
2019259-010-006_36S_039_01.mat	36S
2019259-010-006_39_027_01.mat	39
2019259-010-006_41S_029_01.mat	41S
2019259-010-006_43S_030_01.mat	43S
2019259-010-006_44S_004_01.mat	44S
2019259-010-006_45_031_01.mat	45
2019259-010-006_46S_002_01.mat	46S
2019259-010-006_53_008_01.mat	53
2019259-010-006_57B_038_01.mat	57B
2019259-010-006_59_040_01.mat	59
2019259-010-006_60B_036_01.mat	60B
2019259-010-006_60C_045_01.mat	60C
2019259-010-006_64_033_01.mat	64
2019259-010-006_Big Mossy_019_01.mat	Big Mossy
2019259-010-006_Big Mossy(1)_018_01.mat	Big Mossy
2019259-010-006_W1_013_01.mat	W1

2019259-010-006_W2_024_01.mat	W2
2019259-010-006_W3_015_01.mat	W3
2019259-010-006_W4_028_01.mat	W4
2019259-010-006_W5_011_01.mat	W5
2019259-010-006_W6_032_01.mat	W6
2019259-010-006_W7_010_01.mat	W7
2019259-010-006_W8_007_01.mat	W8
2019259-010-006_W9_001_01.mat	W9
2019259-010-006_W10_037_01.mat	W10
2019259-010-006_W11_043_01.mat	W11
2019259-010-006_W12_034_01.mat	W12
2019259-010-006_W13_006_01.mat	W13
2019259-010-006_W14_009_01.mat	W14

3.2 Changes/Corrections/Comments

Seabird Profile information/flags:

- Seabird Temperature Sensor 5116 pre-season calibration exceeds specifications. Please see Temperature Calibration Report 10493. A post corrected equation has been made available in the calibration report if required by user. Unit has been sent back to Seabird for repair. Please note that specific conductance and dissolved oxygen values are calculated with this temperature data. Specific conductance and dissolved oxygen sensors passed pre-season calibration. More information can be made available upon request.
- PSN W9 was not a full profile, therefore not processed into a bin averaged file.
- PSN 23S was mislabelled as PSN 28, the hex file was corrected using the field log.
- PSN 41S was mislabelled as PSN W4, the hex file was corrected using the field log.
- Two profiles were processed for PSN Big Mossy. The filenames were 2019259-010-006_Big Mossy(1)_018_01 and 2019259-010-006_Big Mossy_019_01. The profile with the filename 2019259-010-006_Big Mossy(1)_018_01 appears to be a duplicate copy of the profile with the filename 2019259-010-006_Big Mossy_019_01.
- Seabird 5116 was used for all profiles.
- The default SOC for SBE 5116 (0.5146) was used for every profile. This calculation should be taken into consideration for further DO analyses. Detailed information on the calculation of new SOC values can be made available upon request.
- Underwater PAR data is not corrected to surface PAR.
- Filenames, PSN, latitudes, and longitudes were added or corrected in the files where necessary (compared to the 2019 NAMA0 Field Log FINAL_301019).

4. Map of Stations

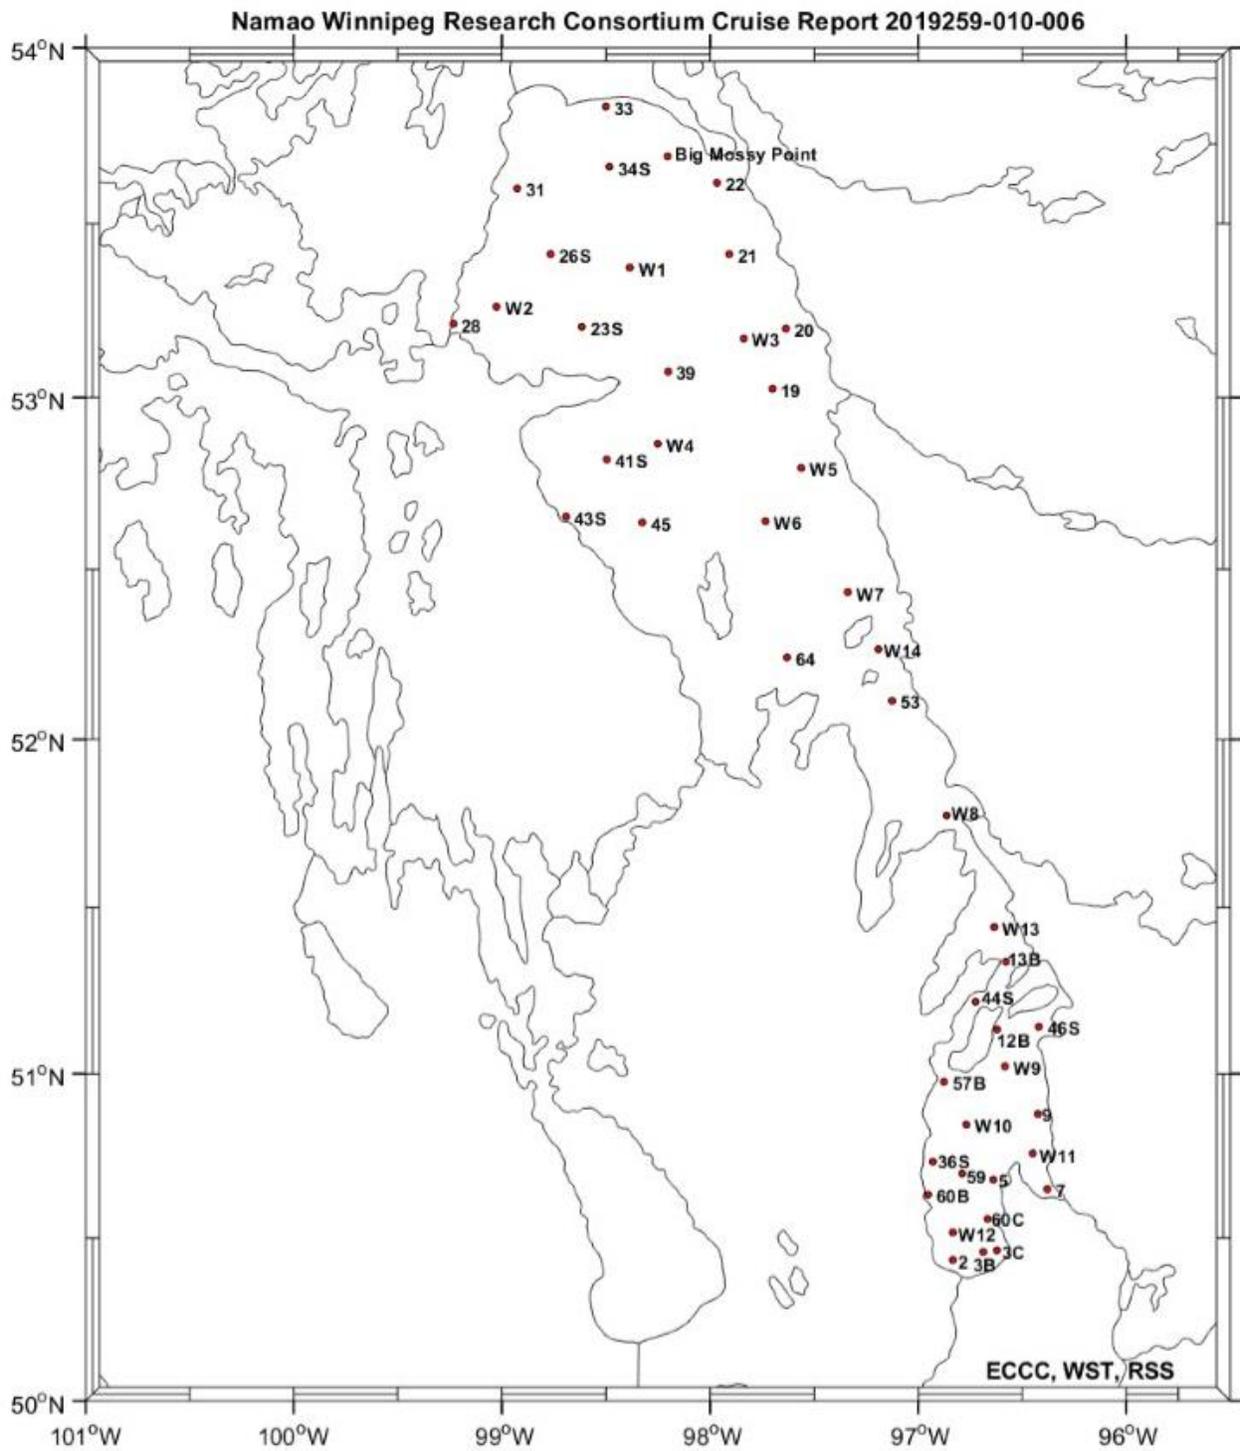


Figure 4-1. Plot of SeaBird profile stations visited during the Nainiwan Research Consortium Cruise 2019259-010-006.

5. Corrective Action

The calibration coefficients for the four optical sensors (Turbidity and Chlorophyll) are in the SeaBird .xmlcon files, using the User Polynomial option. Table 5.1 below lists the voltages, and user polynomial identifiers for each parameter.

Table 5-1. Informative list of the voltages associated with the optical parameters attached to the SeaBird 19+ SN. 5116.

Probe	A/D Voltage Channel in .xmlcon file	SeaSaveV2 Display	SBEDataProcessing – Win32
Turbidity (T)	3	User Polynomial, 2	Upoly 1, Turner Cyclops Turbidity (NTU)
Chlorophyll (C)	1	User Polynomial	Upoly 0, Turner Chlorophyll (RFU)

Post-processing of the raw .hex files from the SeaBird are primarily done using the SBE Data Processing software (SeaBird Data Processing Version 7.23.2, SeaBird Electronics 2014). The following steps are taken:

1. Data Conversion – Parameters independent of temperature and those not requiring filtration and correction with rate of descent are collected here (Scan Count, Pressure (db), Temperature (°C), Conductivity ($\mu\text{S}/\text{cm}$), Oxygen raw (V), Turbidity (NTU), Chlorophyll (RFU), PAR/Irradiance).
2. Filter – Low pass filter A is set to 1 for pressure. Low pass filter B is set to 0.5 (for sampling at 2 Hz) for temperature and conductivity.
3. Align CTD – Advance values are set to 0.5 for Temperature, 0.1 for Conductivity and 4 for Oxygen, raw.
4. Loop Edit – Minimum speed is set to 0.01 m/s. Percent of Mean Speed is set to 10% with a window size of 300. Surface Soak is removed at a depth of 1m. Min/Max soak depths are 0.5 m and 2 m respectively.
5. Derive – Parameters dependent on temperature and influenced by the rate of decent are derived here (Depth (m), Specific Conductance ($\mu\text{S}/\text{cm}$), Oxygen (mg/l), Oxygen (%saturation)).
6. Bin Average – Depth, interpolated is selected with a bin size of 0.5. The data flagged in the Loop Edit step are not used in the interpolation.

To correct the voltage readings from the Turner probes, MilliQ is used as a reference, in the dark, to “zero” the sensors and formazin at 126 NTU is used as the second standard for turbidity. These values are collected once at the start of the field season and are used to correct each optical sensor to RFUB units (and NTU for turbidity). At the end of the field season, a check will be done again to verify minimal drift in each sensor. Any necessary corrections will be made at that time, assuming linear drift.

The profiling protocol is to submerge the Seabird at 3m (to ensure the top of the plumbing is submerged) and hold for 400 scan counts. The Seabird is then brought up to approximately 1m or to the minimum depth where the Y-tubing is not exposed at the water surface. It is to be held there for 100 scan counts, and then profiled at 10% speed through the water column. Once the Seabird has completed its profile, it is to be raised from the bottom for 20 scan counts. Recording can now be stopped and the Seabird

brought back up to the surface. Dissolved oxygen check protocols and Seabird cleaning protocols have been made available onboard the Namao.

To avoid inadvertently repeating cruise numbers, or going out in the field without a pre-defined cruise number, an updated nomenclature will ensure duplicates are impossible and the number can be easily determined anytime of the year. See Research Support Cruise Numbers 2016 document for a list of lake and ship reference numbers.

YYYYJDN-LLL-SSS

YYYYJDN – Seven digit cruise start date

LLL – Three digit lake number

SSS – Three digit ship/small boat number

6. References

DePalma, S., 2010. Quality assurance procedures for shipboard depth-dependent profiled data. Document RS-10-002, Environment Canada, Canada Centre for Inland Waters, Burlington, ON.

END